

Step-by-Step Application Instructions – C² Remove

Before beginning, always read SDS and technical data sheet for complete instructions and safety information. Always prepare a test panel before proceeding.

- Use to remove wax, curing compounds, cure marks, low-solid sealers

COVERAGE RATES

- Standard coverage rate for concentrated, non-diluted cleaner
 - 7.5 – 12.5 m²/L

PLEASE NOTE: Coverage rates are offered for estimating purposes only. Variations in concrete quality, porosity, job site conditions, temperature and relative humidity will affect coverage rates.

DILUTION

The product should be diluted with clean water, based upon its intended use:

- For removal of light wax buildup, dilute 1:10 parts water.
- For removal of heavy wax buildup, dilute 1:3 parts water.
- For removal of low-solids cure and seals, use product at full strength.

APPLICATION

- C² Remove™ can be applied two different ways: (pressure washing is not recommended)
 1. **Sprayer & Auto-Scrubber.** Apply properly diluted C² Remove™ with low-pressure pump sprayer. Let it dwell on surface for 5-10 minutes. Do not allow to dry. Over dwelling C² Remove™, run auto-scrubber with hot water, stiff bristle brushes (not pads), max-down pressure and lowest water setting for best performance. Heated water (65-80°C) may improve cleaning efficiency. Using too much water will only further dilute C² Remove™ lowering its performance. Do not run vacuum at this point. You want C² Remove™ to be worked in to the surface for at least 2-3 passes with auto-scrubber. Do not allow to dry. After 2-3 passes, vacuum up residue. The floor needs to be rinsed well with clean water to insure no residue is left behind.



- 2. Auto-Scrubber (Only).** Apply properly diluted C² Remove™ into auto-scrubber tank. Run auto-scrubber with hot water, stiff bristle brushes (not pads), max-down pressure and lowest water setting for best performance. Heated water (65–80°C) may improve cleaning efficiency. Using too much water will only further dilute C² Remove™, lowering its performance. Do not run vacuum at this point. You want C² Remove™ to be worked into the surface for minimum 3–4 passes with auto-scrubber. More passes are needed since C² Remove™ was not allowed to dwell prior to auto scrubbing. Do not allow to dry. After 3–4 passes, vacuum up residue. The floor needs to be rinsed well with clean water to ensure no residue is left behind.